PRINT DATE: 07/26/99 PAGE: 1

FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL HARDWARE

NUMBER: 05-6-2214 -X

SUBSYSTEM NAME: ELECTRICAL POWER DISTRIBUTION & CONTROL

REVISION: 0

05/03/88

PART DATA

PART NAME

PART NUMBER

VENDOR NAME

VENDOR NUMBER

LRU : PANEL R1A1

V070-730275

SRU

: SWITCH, TOGGLE

ME452-0102-7301

EXTENDED DESCRIPTION OF PART UNDER ANALYSIS:

SWITCH, TOGGLE, 3PDT - MAIN DC BUS TO ESSENTIAL BUS RPC CONTROL

REFERENCE DESIGNATORS:

32V73A1A1S4

32V73A1A1S5

32V73A1A1S6

QUANTITY OF LIKE ITEMS: 3

THREE REQUIRED - ONE PER ESSENTIAL BUS.

FUNCTION:

PROVIDES REMOTE MANUAL CONTROL CAPABILITY TO CONNECT TWO MAIN DC BUSES TO OR ISOLATE FROM AN ESSENTIAL BUS. THIRD CONTACT SUPPLIES ESSENTIAL BUS. POWER FOR FLIGHT DECK PANELS R1, R2, R12, F9, C3, O6, O7, O8, O14, O15, O16 AND A11,

FAILURE MODES EFFECTS ANALYSIS FMEA - CIL FAILURE MODE

NUMBER: 05-6-2214-02

REVISION#: 1

07/26/99

SUBSYSTEM NAME: ELECTRICAL POWER DISTRIBUTION & CONTROL

LRU: PANEL R1A1
ITEM NAME: SWITCH, TOGGLE

CRITICALITY OF THIS

FAILURE MODE: 1R2

FAILURE MODE:

SHORTS TO GROUND (ESSENTIAL BUS TO FLIGHT DECK PANELS CONTACT)

MISSION PHASE:

LO LIFT-OFF

OO ON-ORBIT

DO DE-ORBIT

VEHICLE/PAYLOAD/KIT EFFECTIVITY:

102 COLUMBIA

103 DISCOVERY

104 ATLANTIS

105 ENDEAVOUR

CAUSE:

PIECE PART STRUCTURAL FAILURE, CONTAMINATION, VIBRATION, MECHANICAL SHOCK,

PROCESSING ANOMALY

CRITICALITY 1/1 DURING INTACT ABORT ONLY? NO

REDUNDANCY SCREEN

A) PASS

B) PASS

C) PASS

PASS/FAIL RATIONALE:

A)

B)

C)

- FAILURE EFFECTS -

(A) SUBSYSTEM:

LOSS OF ONE ESSENTIAL BUS IN FLIGHT DECK PANELS

PRINT DATE: 07/26/99

PAGE: 5

FAILURE MODES EFFECTS ANALYSIS (FMEA) — CIL FAILURE MODE NUMBER: 05-6-2214-02

(B) INTERFACING SUBSYSTEM(S):

LOSS OF THE ASSOCIATED FUEL CELL CONTROLLER AND, CONSEQUENTLY, THE ASSOCIATED FUEL CELL. LOSS OF FUEL CELL CONTROLLER REQUIRES FUEL CELL TO BE SHUTDOWN (CLOSE REACTANT VALVES OR REMOVE ALL LOADS FROM THE AFFECTED FUEL CELL) WITHIN NINE MINUTES DUE TO LOSS OF FUEL CELL COOLANT PUMPS.

(C) MISSION:

POSSIBLE ABORT DECISION REQUIRED FOR LOSS OF ONE ESSENTIAL BUS IN THE FLIGHT DECK PANELS.

(D) CREW, VEHICLE, AND ELEMENT(S):

FIRST FAILURE - NO EFFECT

(E) FUNCTIONAL CRITICALITY EFFECTS:

POSSIBLE LOSS OF CREWIVEHICLE AFTER SECOND FAILURE (SECOND SIMILAR SWITCH FAILURE) DUE TO LOSS OF TWO FUEL CELLS DURING ASCENT OR ENTRY WHICH RESULTS IN A POSSIBLE UNDERVOLTAGE CONDITION TO CRITICAL LOADS.

-DISPOSITION RATIONALE-

(A) DESIGN:

REFER TO APPENDIX A, ITEM NO. 1 - SWITCH, TOGGLE

(B) TEST:

REFER TO APPENDIX A, ITEM NO. 1 - SWITCH, TOGGLE

GROUND TURNAROUND TEST

ANY TURNAROUND CHECKOUT TESTING IS ACCOMPLISHED IN ACCORDANCE WITH OMRSD.

(C) INSPECTION:

REFER TO APPENDIX A, ITEM NO. 1 - SWITCH, TOGGLE

(D) FAILURE HISTORY:

CURRENT DATA ON TEST FAILURES, FLIGHT FAILURES, UNEXPLAINED ANOMALIES, AND OTHER FAILURES EXPERIENCED DURING GROUND PROCESSING ACTIVITY CAN BE FOUND IN THE PRACA DATA BASE.

PAGE: 6 PRINT DATE: 07/26/99

FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL FAILURE MODE

NUMBER: 05-6-2214-02

(E) OPERATIONAL USE:

AFTER MECO, FLIGHT CREW PERFORMS FUEL CELL SHUTDOWN PROCEDURE AND MANAGES POWER FOR LOSS OF ONE FUEL CELL.

- APPROVALS -

EDITORIALLY APPROVED
TECHNICAL APPROVAL

: BNA

: VIA APPROVAL FORM

J. Komura 7-26-49

96-CIL-025_D5-6